Track Light Installation Instructions

Install the 4' track so that it is parallel with the finished wall, mounting the track 3' away from the finished wall. The center of the track should be roughly in line with the center of the GL logo sign. Place one light head on each end of the track and adjust lighting so that the left head focuses on the 'H' logo panel of the sign, and the right panel focuses on the panel to the right of it.

READ AND UNDERSTAND THESE INSTRUCTIONS BEFORE INSTALLING FIXTURE

This fixture is intended for installation in accordance with the National Electrical Code and local regulations. To assure full compliance with local codes and regulations, check with your local electrical inspector before installation. To prevent electrical shock, turn off electricity at fuse box before proceeding.

Retain these instructions for maintenance reference.

IS:6020

A1103

Page 1 of 4

INSTALLATION INSTRUCTIONS FOR BASIC LYTESPAN® TRACK LIGHTING INDIVIDUAL AND JOINER TRACK UNITS

Basic Lytespan track lighting is designed to support and energize Lytespots* which can be attached anywhere along the track. It is a 2-conductor system, polarized and continuously grounded throughout, to be supplied by a single 120V, 60 Hz, 20 amp. branch circuit. It may be used with electrical fittings identified for use with Basic Lytespan Track. It is not intended for use with a power cord or a convenience receptacle adaptor. It is not intended to be pendant mounted by flexible cable. Basic Lytespan is listed by Underwriters Laboratories, Inc.

IMPORTANT SAFETY INSTRUCTIONS


WHEN INSTALLING OR USING THIS TRACK SYSTEM, BASIC SAFETY PRECAUTIONS SHOULD ALWAYS BE FOLLOWED, INCLUDING THE FOLLOWING:


- READ ALL INSTRUCTIONS
- THIS TRACK SYSTEM IS INTENDED FOR INSTALLATION IN ACCORDANCE WITH THE NATIONAL ELECTRICAL CODE AND LOCAL OR FEDERAL CODE SPECIFICATIONS.
- DO NOT INSTALL THIS TRACK IN WET OR DAMP LOCATIONS.
- DO NOT INSTALL ANY PART OF THE TRACK SYSTEM LESS THAN 5 FEET ABOVE THE FLOOR.
- DO NOT INSTALL ANY FIXTURE ASSEMBLY CLOSER THAN 6 INCHES FROM ANY CURTAIN, OR SIMILAR COMBUSTIBLE MATERIAL.
- TO PREVENT ELECTRICAL SHOCK, TURN OFF ELECTRICITY AT FUSE BOX BEFORE INSTALLING THE TRACK OR ADDING TO OR CHANGING THE CONFIGURATION OF THE TRACK.
- · INSTRUCTIONS FOR GROUNDING PER INSTRUCTION SHEET OF THE FEED-IN KIT USED MUST BE FOLLOWED. FAILURE TO DO SO MAY RESULT IN A HAZARDOUS CONDITION.
- USE #12 OR 14 GA. AWG SOLID WIRE ONLY (NOT STRANDED WIRE) FOR SUPPLY TO TRACK.
- OBSERVE POLARITY, (NEUTRAL) WHITE SUPPLY LEAD TO CONTACT MARKED "NEUT" IN LIVE END.
- DO NOT ATTEMPT TO ENERGIZE ANYTHING OTHER THAN TRACK LIGHTING FIXTURES ON THE TRACK. TO REDUCE THE RISK OF FIRE AND ELECTRICAL SHOCK, DO NOT ATTEMPT TO CONNECT POWER TOOLS, EXTENSION CORDS, APPLIANCES AND THE LIKE TO THE TRACK.

SAVE THESE INSTRUCTIONS





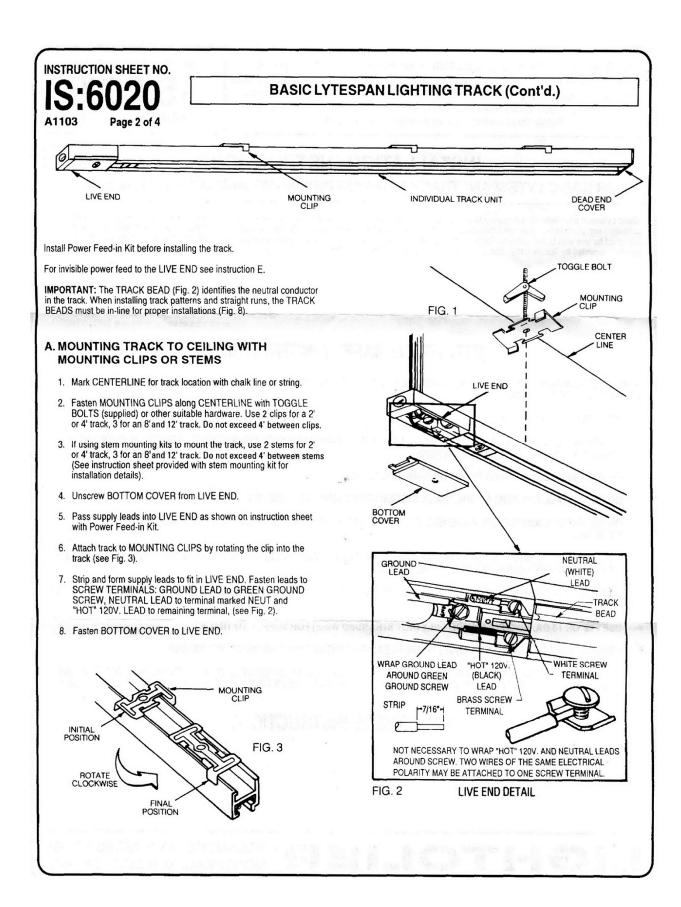

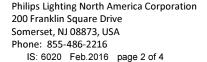



INSTRUCTION SHEET NO. BASIC LYTESPAN LIGHTING TRACK (Cont'd.) JOINER TRACK UNIT (8'UNIT) INDIVIDUAL TRACK UNIT (2', 4' OR 8' UNIT) **B. STRAIGHT CONTINUOUS RUN OF TRACK UNITS** Extend CENTERLINE to length of additional track(s) and fasten additional MOUNTING CLIPS required, (see instruction A-2). Do not exceed 4' between MOUNTING CLIPS. 2. Remove DEAD END COVER from INDIVIDUAL TRACK UNIT. 3. Plug COUPLER of JOINER TRACK UNIT into INDIVIDUAL TRACK UNIT. 4. Rotate MOUNTING CLIPS into track to secure track to ceiling (see Fig. 3). 5. Tighten (2) COUPLER SCREWS. 6. Install additional JOINER TRACK UNITS in the same manner. 7. Insert DEAD END COVER into end of last JOINER TRACK UNIT in run. TRACK BEAD TRACK BEAD O.K. TRACK BEADS IN LINE O.K. TRACK BEADS IN LINE NO! TRACK BEADS NOT IN-LINE NO! TRACK BEADS NOT IN-LINE FIG. 8 PLUG IN JOINER TRACK INDIVIDUAL TRACK UNIT **DEAD END COVER** COUPLER FIG. 4 **COUPLER SCREW**





INSTRUCTION SHEET NO.

IS:6020

A1103

Page 4 of 4

BASIC LYTESPAN LIGHTING TRACK (Cont'd.)


C. FIELD CUTTING TRACK

Track may be cut at the end of a single track unit or at the end of a run of track units.

- 1. Remove DEAD END COVER.
- Cut track with hacksaw (preferably in a miter box to insure a square cut). Remove burrs with a file. If the track conductors come out of the liner, push them back into the liner using a screwdriver.
- 3. Insert DEAD END COVER into the cut track.

Additional track and IN-LINE, L, T, X or VARIABLE ANGLE CONNECTORS may be attached to a cut track.

 If an electrical connector is being installed into the cut section of track; open the gap of both copper conductors to 1/32" gap. Don't open the gap more than 3/16" from the cut edge of the track.

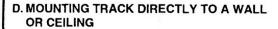

TRACK may be mounted directly to a surface through existing holes in the TRACK (Fig. 6).

CAUTION: NYLON INSULATORS ARE REQUIRED TO ISOLATE THE SCREWS FROM THE TRACK CONDUCTORS.

CAUTION: WHEN WALL MOUNTING TRACK DO NOT USE MOUNTING CLIPS; MOUNT TRACK DIRECTLY TO SURFACE AS SHOWN (FIG. 6).

E. INVISIBLE POWER FEED TO LIVE END

- 1. Remove KNOCK-OUT from LIVE END.
- 2. Remove BOTTOM COVER from LIVE END.
- Thread 3/8" BX CONNECTOR into LIVE END. Orient the screw of the BX CONNECTOR so it lies within the width of the LIVE END. The NUT can be rotated by using a screwdriver to assist in orienting the BX connector.

NOTE: Special care must be taken when making the hole in the mounting surface to prevent the hole from being visible when the track is mounted. If a ROMEX connector is being used the screws on the connector may have to be cut to conceal the mounting hole.

- Pass leads through BX CONNECTOR and LIVE END and secure conduit to BX CONNECTOR.
- 5. Follow instructions #5, #6 and #7 in Section A.

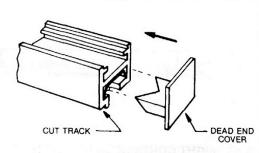
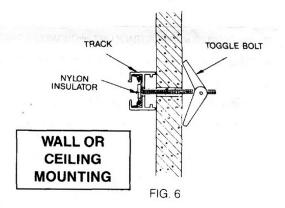


FIG. 5



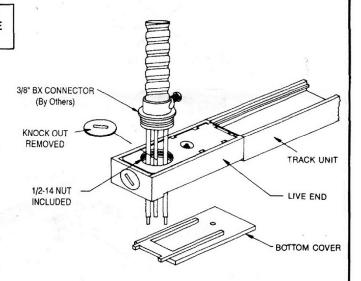


FIG. 7



